

# Copy of Fuel and Air Saver Customer's NAPA Oil Analysis Report


**NAPA**  
**Filters**  
 Oil Analysis Report

**CUSTOMER NO.:**  
**UNIT NO.:** TACOMA  
**DESCRIPTION:** GASOLINE ENGINE  
**END USER:**  
  
**END USER LOCATION:** FAIRHOPE, AL

**MAKE:** TOYOTA  
**MODEL:** TACOMA  
**OIL BRAND:** CASTROL  
**OIL TYPE:** 5W30  
**SERIAL NO.:**  
**FUEL TYPE:** GASOLINE

SAMPLE DATA			SPECTROCHEMICAL ANALYSIS (ppm)																	PHYSICAL PROPERTIES								
LAB#	SAMPLE DATE RECEIPT DATE	TIME ON OIL TIME ON UNIT	IRON	CHROMIUM	LEAD	COPPER	TIN	ALUMINIUM	NICKEL	SILVER	SILICON	BORON	SODIUM	MAGNESIUM	CALCIUM	BARIUM	PHOSPHORUS	ZINC	MOLYBDENUM	TITANIUM	VANADIUM	POTASSIUM	FUEL (%VOL)	VIS @ 40 CcSt	VIS @ 100 CcSt	WATER (%VOL)	SOOT/SOLIDS (%WT)	COOLANT
16707	02/02/2005	11200	6	0	4	11	0	2	0	20	20	1	8	10	1828	0	712	983	2	0	0	0	<1	N/A	10.4	0.1	0.1	NEG
ABNORMAL	02/08/2005	50200																										
150976	12/05/2005	12350	9	0	5	5	0	3	0	25	25	68	11	58	2050	0	663	862	34	0	0	0	<1	N/A	9.28	0	N/A	NEG
NORMAL	12/20/2005	62550																										
134870	12/06/2006	11450	7	0	6	5	0	4	0	15	15	7	4	45	1797	0	664	848	59	0	0	0	<1	N/A	10.3	0	N/A	NO
NORMAL	12/19/2006	73900																										

LAB#	ADDITIONAL TESTS
	TAN
16707	2.8
150976	2.0
134870	2.2

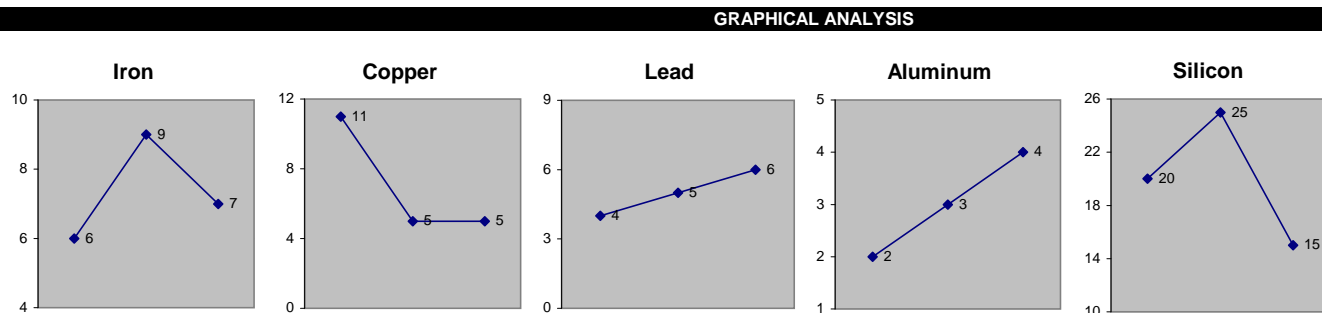

Miles: 73900, 62550, 50200

**Key**  
 A: Abnormal      C: Critical

LAB#	ANALYSIS RECOMMENDATIONS	ANALYST
16707	TRACE LEVEL OF WATER DETECTED. NOTE: TEST RESULTS INDICATE THIS OIL IS IN THE SAE 30 RANGE. NO FUEL DILUTION DETECTED THIS SAMPLE. EXCESSIVE WEAR IS NOT INDICATED. NO RECOMMENDED ACTION AT THIS TIME RESAMPLE AT NORMAL INTERVALS	ANALYST-MHC
150976	RESULTS OF TEST PERFORMED INDICATE NO CORRECTIVE ACTION REQUIRED	ANALYST-GGD
134870	RESULTS OF TEST PERFORMED INDICATE NO CORRECTIVE ACTION REQUIRED	ANALYST-A.A